

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 36

Township: 7 North


Range: 1 East

Corner ID: Polk W-25

Monument Description & Remarks: R.R. Spike set over 3" Aluminum cap, "1986, S.O. 336, 1/4 S.36" 1ft below ground. Survey Sign 3.5ft above ground at pt. B


References On File: Victor H. McCauley land corner record, Forest Service Tie (1986), on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 41 Page No. 36

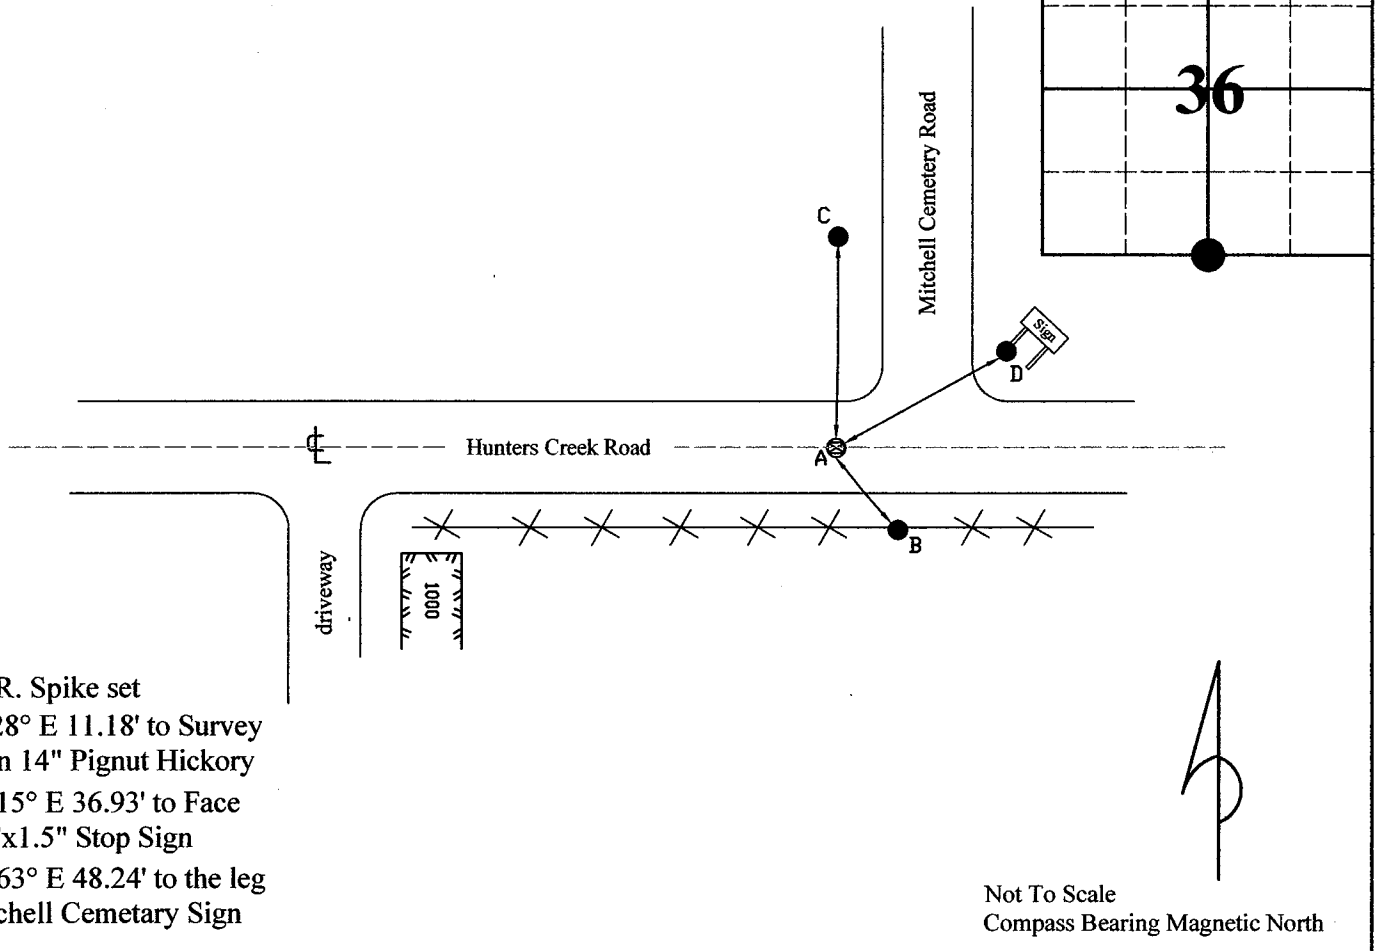

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 3rd day of September, 2008.

Kevin P. Enright

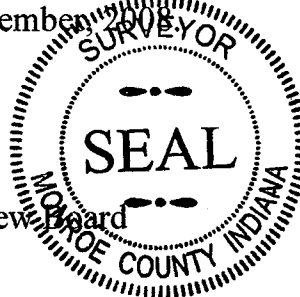

Administered by the Monroe County Surveyor Review Board

Date: 10/7/2008


Index No. 2-23
(Alphabetical - Numerical): AND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7100-74 (Rev. 5/80)

T. 7N R. 1E 2nd Mer. N.F. Hoosier County Monroe State Indiana
S 4 Corner common to sections 36 and

EXISTING SURVEYS

Original Government Survey	Original Evidence Found
Year surveyed <u>1811</u>	Year of search <u>1986</u> By <u>V.H.M.</u>
Original monument <u>Wood Post</u> (wood post, stone, pile of stones, pipe, etc.)	Monument found <u>None</u>
Bearing Trees	Original Bearing Trees Found
Species <u>Beech</u> <u>Sugar</u>	Species _____
Diameter <u>6"</u> <u>15"</u>	Diameter _____
Bearing <u>N 80 E</u> <u>S 67 W</u>	Bearing _____
Distance <u>16 Lks</u> <u>19 Lks</u>	Distance _____
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Year surveyed <u>1859</u> By <u>James W. Spencer</u>	Year of search <u>1986</u> By <u>V.H.M.</u>
Where filed or recorded <u>Monroe Co. Survey Books Pg. 10</u>	<u>No evidence recovered.</u>
Monument <u>_____</u> (Original, concrete post, iron rod, etc.)	_____
_____	_____
Bearing Trees, Reference Objects	Bearing Trees, Reference Objects
Species <u>W Oak</u> <u>Ash</u>	_____
Diameter <u>18"</u> <u>1"</u>	_____
Bearing <u>N 7 W</u> <u>S 75 E</u>	_____
Distance <u>288 Lks.</u> <u>9 1/4 Lks.</u>	_____

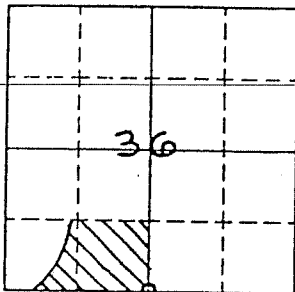

Sketch

O Corner F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc. Cite source of testimony if any. Corner is situated in east-west county road. Near "T" road north to Mitchell Cemetery.

Perpetuation Record

Monument and accessories established. Include brief description of area.
Set aluminum monument 4" below road surface.

Unmarked Accessories Established:

Mockernut	Mockernut	Mockernut	Metal Drain
Hickory	Hickory	Hickory	Pipe
23"	20"	13"	24"
S 68 W	S 37 W	S 5 E	West
46.5'	22.9'	28.8'	37.8'

Certified corner restoration certificate prepared. Yes X No _____
Filed in county records at _____ Date _____ County Document No. _____
Identified on serial data No. _____

At time of search:

1. Did you have the record description?

Yes X No _____

2. How was search area located?

Pacing, chaining, photos, maps,
etc. chaining3. Man hours spent in search 24. Do you think additional search might
recover evidence? Yes _____ No X5. Signature Kathy H. McCarl

Index No. 2-23
(Alphabetical - Numerical)LAND CORNER RECORD
(RECTANGULAR SURVEYS)


R9-7150-4 (Rev. 6/13/67)

GPO 806-924

T. 7N R. 1E Mer. N.F. Hoosier County Lawrence State Indiana
1/4 Section Corner common to sections 36 and

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed <u>1811</u>	Original monument <u>Wood post</u> (Wood post, stone, pile of stones, pipe, etc.)	Year of search <u>1972</u> By <u>H. Deaton</u>	Monument found <u>No</u>
Bearing Trees		Original Bearing Trees Found	
Species <u>Beech</u> <u>Sugar</u>		Species	
Diameter <u>6"</u> <u>15"</u>		Diameter	
Bearing <u>N80°E</u> <u>S67°W</u>		Bearing	
Distance <u>16 lks</u> <u>19 lks</u>		Distance	
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed <u>1859</u> By <u>James Spencer</u>	Where filed or recorded <u>Monroe Co. Survey Bk. pg. 10</u>	Year of search <u>1972</u> By <u>Henry Deaton</u>	
Monument <u></u> (Original, concrete post, iron rod, etc.)			
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species <u>White</u> <u>Ash</u>		<u>None</u>	
Diameter <u>18"</u> <u>1/2"</u>			
Bearing <u>N07°W</u> <u>S75°E</u>			
Distance <u>288 lks</u> <u>9 1/2 lks</u>			

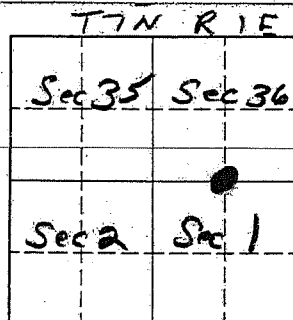

At time of search:

1. Did you have the record description?

Yes ☒ No ☐

2. How was search area located?

Pacing, chaining, photos, maps,

etc. pacing, photos, maps3. Man hours spent in search 1 hr.4. Do you think additional search might recover evidence? Yes ☐ No ☒5. Signature H Deaton

Relation of Evidence to Record Features Along Section Lines

Section line to sections 36 - 1

Object Creek 3 lks wide

Record distance 8 ch E

Measured distance past 11 ch

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc. Cite source of testimony if any. Location of corner appears to be in the center of gravel road. If a stone was ever set at this corner it has probably been disturbed. Paced East along road and did not find above stream at record distance. Found stream at approximately 11 chains.

Perpetuation Record

Monument and accessories established. Include brief description of area.

Corner appears to be in center of gravel road. Stone has probably been disturbed

Certified corner restoration certificate prepared: Yes ☐ No ☐

Filed in county records at _____ Date _____ County Document No. _____

Identified on aerial photo No. _____ Which is filed at _____

Index No. Z-23
(Alphabetical - Numerical)LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)

GPO 806-924

T. 7N R. 1E 2nd Mer. N.F. Hoosier County Lawrence State Ind
1/4 section Corner common to sections 36 and 12 1/2

EXISTING SURVEYS

Original Government Survey

Year surveyed 1871
Original monument Wood post
(Wood post, stone, pile of stones, pipe, etc.)

Bearing Trees

Species Beech Sugar
Diameter 6" 15"
Bearing N 80° E S 67° W
Distance 16 lks 19 lks

Subsequent Corner Restoration

Year surveyed 1859 By James Spencer
Where filed or recorded Morris Co. Survey Bk. pg. 10
Monument
(Original, concrete post, iron rod, etc.)

Bearing Trees, Reference Objects

Species White Oak Ash
Diameter 18" 12"
Bearing N 07° W S 73° E
Distance 288 lks 9 1/2 lks

Original Evidence Found

Year of search 1972 By H. Denton
Monument found No

Original Bearing Trees Found


Species
Diameter
Bearing
Distance

Evidence of Subsequent Corner Restoration Found

Year of search 1972 By Henry Denton

Bearing Trees, Reference Objects

None

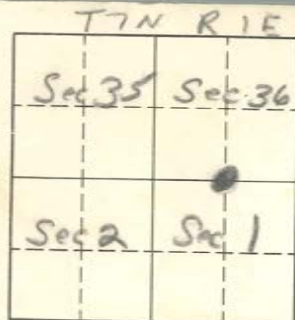

Sketch

○ Corner ▨ F.S. Land

At time of search:

1. Did you have the record description?

Yes ☒ No ☐

2. How was search area located?

Pacing, chaining, photos, maps,

etc. pacing, photos, maps

3. Man hours spent in search 1 hr.

4. Do you think additional search might recover evidence? Yes ☐ No ☒

5. Signature N Deaton

Relation of Evidence to Record Features Along Section Lines

Section line to sections 36 - 1

Object

Creek 1/2 mi wide

Record distance

8 ch E

Measured distance

point 11 ch

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any. Location of corner

appear to be in the center of gravel road.

If a stone was ever set at this corner it has
probably been disturbed.

Paced East along road ~~to~~ and did not find
above stream at record distance. found stream
at approximately 11 chains

Perpetuation Record

Monument and accessories established. Include brief description of area.

Corner appears to be in center of gravel road. Stone
has probably been disturbed

Certified corner restoration certificate prepared:

Yes ☐ No ☐

Filed in county records at

Date

County Document No.

Identified on aerial photo No.

Which is filed at